

Firmware Release Notes

FIR-v1825-B577172

- internal changes only

FIR-v1813-B557134

- General:
 - Wrong default threshold for ballast circuit
 - Velocity and acceleration feed forward did not work in IP mode and were wrongly scaled in CSP and clock-direction mode
 - Correction of the automatic brake control with step direction
- Autoseup:
 - Correction of the alignment values
- Limit Switches:
 - Removed the tolerance band for limit switches
- Od:
 - Removed 2059h for devices without encoder configuration capability
 - 2038h is public for all controllers
 - Correction of the default values of 1011h
 - Correction of the default value of 605Ah to 2
- PDI:
 - Enable it by default and support it by Modbus RTU PDOs
 - Adapt the status bits and shift some command figures
- Quick Stop:
 - Support of quick stop option codes 5 & 6 in 605Ah to stay in quick-stop active state

FIR-v1748-B538662